

⑧
④

BHARAT HEAVY ELECTRICALS LIMITED, JHANSI

VAPOUR PHASE PROCESS

Vessel No. 2117/2118

Stage P1/P2

Plant standard: JS0690098,Rev09

Process sequence and critical parameters

1. Preparation/Setting up

- .
- Leakage air pump started.
- Evaporator and condensation system evacuation started.
Evaporator evacuated to 50 torr max and condensation system 30 torr max.
- Heating of solvent in evaporator to 130+/-4°C
- Partial Opening of bypass valve between evaporator and condensor
- Solvent vapor pressure > 60 torr
- Return of condensate from collecting tank to evaporator by condensate pump.
- Vacuum Pumps both Started.
- Evacuation of Vacuum vessel starts
- Booster Starts at 200 torr.
- When Vacuum Achieved 7 mbar or 5 torr next cycle (Heating up) Started

2. Heating Up&Drying

- Solvent Vapour inlet valve opens admitting vapor in the vessel. Heating of job Started by solvent vapour.
- The Condenser and the condensate collecting tanks are maintained vacuum at 15-20torr Automatically with help of leakage air pump.
- Vapour returns starts when job temp. reaches 80 degree centigrade and vapour pressure raises to 30-35 torr in the vessel.
- Job temp. reaches at 105-125 Degree centigrade.
- Continuous 6 reading of job temp. of around 105-125 degree centigrade taken at interval of one hour.
- Vessel and door heating by steam continues from heating &Drying cycle till termination of the process.
- Next cycle (pressure reduction) Starts.

Signature
21/4/18

⑦

③

3. Pressure Reduction

- Evaporator Heating switched off .
- Vapour inlet of solvent in vessel stopped through closing of valve .
- Reduce vessel pressure up to less than 25 torr by air leakage pump .
- This phase must be terminated when the extraction of solvent condensate stop.
- Next cycle (Fine vacuum) Starts .

4. Fine Vacuum

- Vacuum Pumps both Started.
- Evacuation of Vacuum vessel starts
- Booster Starts at 50 torr.
- The vacuum cycle should be stopped when the vessel vacuum achieved 0.2 torr max. and rate of condensed water for six consecutive measurements taken at an interval of one hour shall be 30 ML. and job temp. around at 105-125 degree centigrade.

5. Aeration

- After completion of Fine vacuum process, Aeration is to be done manually via dryer, when job needs to be taken out..

[Signature]
21/6/18

Conventional Process

Vessel No. 2117/2118

Stage P1/P2/P3

Cycle

1- Heating Cycle

- Job Heating started by steam with the help of steam controlled valve Automatically.
- Job Temp. reaches 105 (+ -) 5 degree centigrade.
- 6 consecutive reading of job temp. around 105 (+ -) 5 taken then vaccum cycle started .

2- Vaccum Cycle

- Vaccum Pump started .
- Booster Start at 50 torr vaccum.
- The vaccum cycle should be stopped when the vessel vaccum achieved 0.2 torr max. and rate of condensed water for six consecutive measurements taken at an interval of one hour shall be 30 ML. and job temp. around at 105(+ -) 5 degree centigrade.

3- Aeration

- After completion of Fine vacuum process, Aeration is to be done manually via dryer, when job needs to be taken out..

Lajee Ahmad
21/6/18